



Revision Number: 002.3

Issue date: 09/26/2014


1. PRODUCT AND COMPANY IDENTIFICATION

Product name:	LOCTITE EA 956 AERO PART B 25GR KIT known as EA 956 PART B 25G E-Z PAK	IDH number:	936909
Product type:	Adhesive for the Aerospace Industry	Item number:	AB9112307
Restriction of Use:	None identified	Region:	United States
Company address:	Henkel Corporation One Henkel Way Rocky Hill, Connecticut 06067	Contact Information:	Telephone: (860) 571-5100 MEDICAL EMERGENCY Phone: Poison Control Center 1-877-671-4808 (toll free) or 1-303-592-1711 TRANSPORT EMERGENCY Phone: CHEMTREC 1-800-424-9300 (toll free) or 1-703-527-3887 Internet: www.henkelna.com

2. HAZARDS IDENTIFICATION

EMERGENCY OVERVIEW	
DANGER:	CAUSES SEVERE SKIN BURNS AND EYE DAMAGE. MAY CAUSE AN ALLERGIC SKIN REACTION. MAY CAUSE ALLERGY OR ASTHMA SYMPTOMS OR BREATHING DIFFICULTIES IF INHALED.

HAZARD CLASS	HAZARD CATEGORY
SKIN CORROSION	1B
SERIOUS EYE DAMAGE	1
RESPIRATORY SENSITIZATION	1
SKIN SENSITIZATION	1

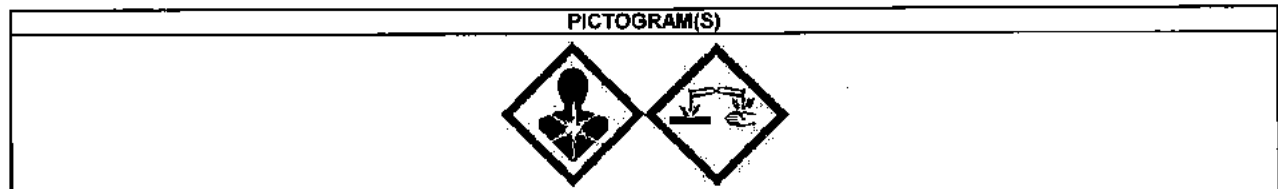

Precautionary Statements

Prevention:	Do not breathe vapors, mist, or spray. Wash thoroughly after handling. Contaminated work clothing should not be allowed out of the workplace. Wear protective gloves, eye protection, and face protection. In case of inadequate ventilation wear respiratory protection.
Response:	IF SWALLOWED: Rinse mouth. Do NOT induce vomiting. If on skin (or hair): Take off immediately all contaminated clothing. IF INHALED: Remove person to fresh air and keep comfortable for breathing. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to remove. Continue rinsing. Immediately call a poison control center or physician. If skin irritation or rash occurs: Get medical attention. If experiencing respiratory symptoms: Call a poison center or physician. Wash contaminated clothing before reuse.
Storage:	Store locked up.
Disposal:	Dispose of contents and/or container according to Federal, State/Provincial and local governmental regulations.

Classification complies with OSHA Hazard Communication Standard (29 CFR 1910.1200) and is consistent with the provisions of the United Nations Globally Harmonized System of Classification and Labeling of Chemicals (GHS).

See Section 11 for additional toxicological information.

3. COMPOSITION/INFORMATION ON INGREDIENTS

Hazardous Component(s)	CAS Number	Percentage*
Amine adduct	Proprietary	60 - 100
Diethylenetriamine	111-40-0	10 - 30
Triethylenetetramine	112-24-3	1 - 5

* Exact percentage is a trade secret. Concentration range is provided to assist users in providing appropriate protections.

4. FIRST AID MEASURES

Inhalation:	Move to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. If symptoms develop and persist, get medical attention.
Skin contact:	Remove contaminated clothing and footwear. Immediately flush skin with plenty of water (using soap, if available). If symptoms develop and persist, get medical attention.
Eye contact:	Immediately flush eyes with plenty of water for at least 15 minutes. Get medical attention.
Ingestion:	Drink water as a precaution. Never give anything by mouth to an unconscious person. Get immediate medical attention.
Symptoms:	See Section 11.

5. FIRE FIGHTING MEASURES

Extinguishing media:	Water spray (fog), foam, dry chemical or carbon dioxide.
Special firefighting procedures:	Wear self-contained breathing apparatus and full protective clothing, such as turn-out gear. Cartridge respirators do not provide adequate protection for fire fighters or exotherm mitigation.
Unusual fire or explosion hazards:	May liberate large quantities of dense, foul-smelling smoke which may contain unidentified toxic gasses.
Hazardous combustion products:	Oxides of carbon and nitrogen, aldehydes, acids and undetermined organics.

6. ACCIDENTAL RELEASE MEASURES

Use personal protection recommended in Section 8, isolate the hazard area and deny entry to unnecessary and unprotected personnel.

Environmental precautions:	Do not allow product to enter sewer or waterways.
Clean-up methods:	Wear suitable protective clothing, gloves and eye/face protection. Soak up with inert absorbent material (e.g. sand, silica gel, acid binder, universal binder, sawdust). Store in a partly filled, closed container until disposal.

7. HANDLING AND STORAGE

Handling: For the Part A plus Part B adhesive mixture, follow curing schedule as recommended in product literature. Do not heat Part B at temperatures greater than 100 °C (212 °F). This material may self-react at higher temperatures and cause an exotherm. The exotherm has the potential for release of excessive energy and toxic gasses. Do not cut, grind, weld, or drill on or near this container. Empty containers retain product residue, so obey hazard warnings and handle empty containers as if they were full.

Storage: For safe storage, store between 0 °C (32°F) and 25 °C (77°F). Keep container closed.

For information on product shelf life, please review labels on container or check the Technical Data Sheet.

8. EXPOSURE CONTROLS/PERSONAL PROTECTION

Employers should complete an assessment of all workplaces to determine the need for, and selection of, proper exposure controls and protective equipment for each task performed.

Hazardous Component(s)	ACGIH TLV	OSHA PEL	AIHA WEEL	OTHER
Amine adduct	None	None	None	None
Diethylenetriamine	1 ppm TWA (SKIN)	None	None	None
Triethylenetetramine	None	None	1 ppm (6 mg/m ³) TWA (SKIN)	None

Engineering controls: Provide adequate local exhaust ventilation to maintain worker exposure below exposure limits.

Respiratory protection: Use NIOSH approved respirator if there is potential to exceed exposure limit(s).

Eye/face protection: Wear chemical goggles; face shield (if splashing is possible).

Skin protection: Use chemical resistant, impermeable clothing including gloves and either an apron or body suit to prevent skin contact.

9. PHYSICAL AND CHEMICAL PROPERTIES

Physical state:	Liquid
Color:	Amber
Odor:	ammoniacal
Odor threshold:	Not available.
pH:	Not determined
Vapor pressure:	< 1.0 mm hg (20 °C (68°F))
Boiling point/range:	207 °C (404.6 °F)
Melting point/ range:	Not determined
Specific gravity:	0.96
Vapor density:	Not determined
Flash point:	> 93 °C (> 199.4 °F)
Flammable/Explosive limits - lower:	Not determined
Flammable/Explosive limits - upper:	Not determined
Autoignition temperature:	Not available.
Evaporation rate:	Not determined
Solubility in water:	Soluble
Partition coefficient (n-octanol/water):	Not determined
VOC content:	< 10 g/l per SCAQMD Rule 1124 [EPA Test Method 24/304-91] (estimated)
Viscosity:	Not available.
Decomposition temperature:	Not available.

10. STABILITY AND REACTIVITY

Stability:	Stable
Hazardous reactions:	May occur.
Hazardous decomposition products:	Oxides of carbon and nitrogen, aldehydes, acids and undetermined organics.
Incompatible materials:	Keep away from strong oxidizing agents, strong Lewis or mineral acids.
Reactivity:	Not available.
Conditions to avoid:	Avoid mixing resin (Part A) and curing agent (Part B) unless you plan to use immediately. Do not heat mixed adhesive unless curing surfaces to be bonded. Failure to observe these precautions may result in excessive heat build-up causing an exotherm.

11. TOXICOLOGICAL INFORMATION

Relevant routes of exposure: Skin, Inhalation, Eyes, Ingestion

Potential Health Effects/Symptoms

Inhalation:	Causes respiratory tract irritation. Vapors and mists will irritate nose and throat and possibly eyes.
Skin contact:	Burns. Repeated or prolonged skin contact may result in allergic sensitization.
Eye contact:	Burns. Severe eye irritation.
Ingestion:	May cause burns of mouth and throat if swallowed.

Hazardous Component(s)	LD50s and LC50s	Immediate and Delayed Health Effects
Amine adduct	None	No Records
Diethylenetriamine	Oral LD50 (RAT) = 1,080 mg/kg Oral LD50 (RAT) = 2.33 g/kg Oral LD50 (RAT) Approximate 1,140 mg/kg	Allergen, Irritant, Eyes
Triethylenetetramine	None	Allergen, Corrosive, Developmental, Irritant, Mutagen

Hazardous Component(s)	NTP Carcinogen	IARC Carcinogen	OSHA Carcinogen (Specifically Regulated)
Amine adduct	No	No	No
Diethylenetriamine	No	No	No
Triethylenetetramine	No	No	No

12. ECOLOGICAL INFORMATION

Ecological information: Not available.

13. DISPOSAL CONSIDERATIONS

Information provided is for unused product only.

Recommended method of disposal: Follow all local, state, federal and provincial regulations for disposal.

Hazardous waste number: Not a RCRA hazardous waste.

14. TRANSPORT INFORMATION

The transport information provided in this section only applies to the material/formulation itself, and is not specific to any package/configuration.

U.S. Department of Transportation Ground (49 CFR)

Proper shipping name: Amines, liquid, corrosive, n.o.s. (Diethylenetriamine, Triethylenetetramine)
Hazard class or division: 8
Identification number: UN 2735
Packing group: II

International Air Transportation (ICAO/IATA)

Proper shipping name: Amines, liquid, corrosive, n.o.s. (Diethylenetriamine, Triethylenetetramine)
Hazard class or division: 8
Identification number: UN 2735
Packing group: II

Water Transportation (IMO/IMDG)

Proper shipping name: AMINES, LIQUID, CORROSIVE, N.O.S. (Diethylenetriamine, Triethylenetetramine)
Hazard class or division: 8
Identification number: UN 2735
Packing group: II

15. REGULATORY INFORMATION

United States Regulatory Information

TSCA 8 (b) Inventory Status: All components are listed or are exempt from listing on the Toxic Substances Control Act Inventory.
TSCA 12 (b) Export Notification: None above reporting de minimis
CERCLA/SARA Section 302 EHS: None above reporting de minimis
CERCLA/SARA Section 311/312: Immediate Health, Delayed Health
CERCLA/SARA Section 313: None above reporting de minimis
California Proposition 65: No California Proposition 65 listed chemicals are known to be present.

Canada Regulatory Information

CEPA DSL/NDL Status: All components are listed on or are exempt from listing on the Canadian Domestic Substances List.

16. OTHER INFORMATION

This safety data sheet contains changes from the previous version in sections: New Material Safety Data Sheet format.

Prepared by: Mark Mau, Regulatory Affairs Specialist

Issue date: 09/26/2014

DISCLAIMER: The data contained herein are furnished for information only and are believed to be reliable. However, Henkel Corporation and its affiliates ("Henkel") does not assume responsibility for any results obtained by persons over whose methods Henkel has no control. It is the user's responsibility to determine the suitability of Henkel's products or any production methods mentioned herein for a particular purpose, and to adopt such precautions as may be advisable for the protection of property and persons against any hazards that may be involved in the handling and use of any Henkel's products. In light of the foregoing, Henkel specifically disclaims all warranties, express or implied, including warranties of merchantability and fitness for a particular purpose, arising from sale or use of Henkel's products. Henkel further disclaims any liability for consequential or incidental damages of any kind, including lost profits.

Distributed by:
Rudolph Bros. & Co.
6550 Oley Speaks Way
Canal Winchester, OH 43110
Phone: 614-833-0707
Fax: 800-600-9508
e-mail: rbcsupport@rudbro.com
www.rudbro.com